

#### HINTS TO CORRESPONDENTS.

Names and Address must accompany all letters, or no attention will be paid thereto. This is for our information, and not for publication.

References to former articles or answers should give date of paper and page or number of question. Inquiries not answered in reasonable time should be repeated; correspondents will bear in mind that some answers require not a little research, and, though we endeavor to reply to sil, either by letter or in this department, each must take his turn.

Special Writtes Information on matters of personal rather than general interest cannot be expected without remuneration.

Scientific American Supplements referred to may be had at the office. Frice 10 cents each.

Books referred to promptly supplied on receipt of price.

Minerals sent for examination should be distinctly marked or labeled.

(1) L. C. asks: Would the carbon, made as described in Scientific American of April 23, 1887, page 266, question 2, do to run the motor described in No. 11, current volume? A. Yes. 2. If so, how large should the carbon be for one large cell, sufficient to give the motor one man power, using the following mixture, which I copy from the Electrical Review: ' Dissolve common soap in boiling water, and add to it small quantities of bran and caustic potash or soda. The mixture forms in the manner of jelly, and will not readily spill." I wish to attach the motor to a vehicle and any liquid will easily spill. A. The motor is not adapted to a single large battery. As we have never seen a practical trial of the soap and caustic potash battery, we are unable to say anything as to its merits. 3. Is it best to have one large cell or a number of smaller e? If it is best to have small cells, how many half gallon or quart cells will be required to run the motor? A. It will require about 8 cells of plunging bichromate battery, with zincs and carbons 5 xi7 inch

(2) P. J. N. writes: Will you please inform me what form, whether round, square, or twisted is best for lightning rods? Also, what material is best? Would it be well to join all the bottoms of the rods, say 4 or 6 rods, to the galvanized two inch pipe of a drive pump, forty feet deep in earth? A. The form of lightning rod is immaterial. Copper is thought to be best. Iron rods of double the diameter of copper have the same capacity. The drive well would form a very good ground, but the surface is rather small. We would advise the use of several grounds consisting of plates of copper buried in moist earth, or of beds of coke having the ends of the rods looped and laid back and forth upon the coke bed, with a covering of coke above the The coke should, of course, be in contact with earth that is always moist.

(3) S. W. C. writes: 1. Are there not some discrepancies in the description of the simple electro motor described in your issue of March 24? For the armature you say to use 12 coils of No. 16 wire, four layers in each coil, and eight convolutions in each layer. This would require 96 convolutions of wire in the circumference of the armature, and as No. 16 insulated wire measures 0'066 (over the insulation), there would have to be about 61/8 inches in which to wind the 12 coils. Now, the inside of the armature, when wound, would be only 1% inches diameter, or about 51% inches in circumference, and therefore could not contain the required number of convolutions. A. Armature may be filled with No. 16 single covered magnet wire, if carefully used, but it is difficult to wind the armature with wire of this size in such way as to get the wire all in. The resistance of the armature is increased somewhat by using finer wire, but owing to the facility with which No. 18 can be wound, it is, perhaps, advisable to use that size instead of No. 16. 2. It is stated that each coil requires about 30 feet of wire. As there are 32 convolutions, and only about 6 inches in each convolution, I do not see how there could be more than about 16 feet. A. There was an error in giving the length of this wire. The length is about 15 or 16 feet.

(4) H. R. S. writes: In winding the ar mature, I am using double covered No. 16 wire, and after winding six coils as described. I find that I shall not have room on the armature to wind the other six oils with eight convolutions. Would the motor run all, right if eleven instead of twelve coils are used, or would it be better to wind the remaining six coils with seven convolutions? I saw in the last issue of your paper that if the coils were wound with unequallengths of wire, that the motion would be irregular. To what extent would be the irregularity of motion, in either of the above cases? Is there any other way than that I have stated, besides rewinding, of overcoming my difficulty? In case I should wind the remaining coils with seven convolutions, should I decrease the amount of wire on the field magnets? In running a sewing machine or lathe, what inconvenience would the irregularity of the motor cause? Would the irregularity be enough to be noticeable in the lathe? A. By using sin the Scientific American as a dynamo, by connecting gle covered wire you will be able to get in the required number of coils. There will be no particular objection to using No. 18 instead of No. 16, if you find your ring too small to receive the No. 16. Slight irregularities of winding, such as you mention, would not have a very serious effect upon the operation of the motor. There ervable irregularity in the rotation.

(5) Montana wishes to know if there is any limit to the height a slphon will work, provided you can get the water started. A. Theoretically, the limit of the action of a siphon is 33 feet high, but practically, only about 26 feet is realized.

(6) G. I. H. asks (1) if the field magnet of the electric motor described in March 17 number of SCIENTIFIC AMERICAN is to be of one piece of Russia iron, or of different pieces, and if of one piece, where can it be obtained? A. It is unnecessary to make the field magnet of a single piece of Russia iron. The strips should be as long as you can conveniently pro-cure. The ends of the strips may be simply abutted. 2.19 any of the wire to be cotton covered, except for winding the armature? A. All of the copper wire used

in the construction of the machine must be insulated. Single covered magnet wire will answer.

(7) H. C. S. writes: I am trying to make a motor like one described in No. 11 of Screw-TIFIC AMERICAN. I find that I cannot wind twelve sections, eight wires wide and four deep, of 16 cotton covered wire. In Mr. Hopkins' directions he says it takes only 30 feet of wire on each section of the armature. What is the cause of the trouble? I find it takes only 16 feet to the section. A. Your inability to wind on the required number of convolutions and layers of wire in the sections of the armature is probably due to one of two causes, or perhaps both. You may have used double or triple covered wire. The wire in the armature illustrated is No. 16 single covered magnet wire. You may have failed to lay the wire straight and truly parallel. The way out of the difficulty is to omit one convolution from each of the last two layers of wire in each coil, or wind the armature with No. 18 The latter plan is preferable. You are right in regard to the length of wire in each coil of the armature. It was erroneously given as 30 feet. It should have

(8) S. J. A. writes: I have wound my field magnet with wire which I bought of the Detroit Electrical Works for No. 16 insulated. Now I findafter one coil is on the armature ring, I cannot get the second in its proper place, the first being too wide. I used four layers, 8 wires wide. What shall I do? Use smaller wire or a less number of convolutions? I have my field magnet all wound, and don't know what to do. A. See answer to H. C. S.

(9) R. M. S. writes: I am making an electric motor as described in Scientific American issued March 17. In the bill of dimensions and quantities, I find I cannot get 30 ft. in each coil on the core. It is specified 4 layers in each coil, and 8 convolutions in each layer. What I wish to know is, is the effectiveness of the motor governed by the proportional amount of wires in armature to the field magnets? If so, does lengthening or shortening the wires in the coils make the motor stronger? I find by actual trial that 15 ft. will fill each coil, thus shortening just one-half. A. See answer to H. C. S.

(10) W. C. F. asks: 1. Would it be well to use a motor run by batteries to run a dynamo to produce light? A. The use of a motor run by batteries to operate a dynamo to produce a light is very much like pumping water by hand to operate a water wheel to run a grist mill. Better use the current from your battery to operate your lights, as you will lose more than half of it in the process you describe. 2. Would the motor of Scientific American, March 17, 1888, run the small dynamo of Scientific American Sur PLEMENT, No. 161? If not, how could the dynamo be changed? A. The motor referred to would not run the dynamo to any advantage. The dynamo could not be changed so as to be run advantageously by means of

(11) B. F. S. writes: I was much interested in an article headed "Simple Electric Motor," in Scientific American of March 17, 1888, and have begun the construction of one. The battery is the point I am in doubt about. The article says, eight cells of plunging bichromate battery, each having one zinc plate 5 x 7 inches, and two carbon plates of same size, will develop enough power, and run an ordinary foot lathe or two or three sewing machines. Does this mean Fuller's mercury bichromate battery or the Grenet battery? Can you refer me to any number of your paper in which I can get a description from which to construct, at moderate cost, a suitable battery to run this motor? A. The battery is of the Grenet type. We have not described a battery of exactly this construction, but expect to do so at an early day.

(12) G. M. C. asks: I want a cement that will bind (1) a strip of rubber, (2) a strip of rough dressed leather to a strip of steel same size, about 14 inches long, and in other dimensions about like the whalebone that goes in a corset. The cement to be firm enough to hold, despite active and frequent motion like that employed in laying on the rod. A. Use a cement composed of equal parts of pitch and gutta percha, with the addition of a very small percentage of some fixed oil-lard oil for example.

(13) W. D. L. asks: 1. Would you please inform me if the small "Electric Motor" described in the SCIENTIFIC AMERICAN SUPPLEMENT, No. 641, would require an electric current of a strength which would make it dangerous in the hands of an inexperienced person? If not, why? A. The current required for the motor is not at all dangerous. 2. Also would the prepared hektograph ink to be had in stationery stores give the same result as that of the formula for use on the copying pad described in the SCIENTIFIC AMERICAN SUPPLEMENT, No. 438? A, The prepared ink will answer the purpose.

(14) H. S. P. writes: 1. I have a one horse power engine in our coffee roasting department. it to line shaft and driving it with the engine? Could I develop enough electricity to make one or more small incandescent lights? A. By using a cast iron field magnet and winding the armature with finer wire you will be able to produce a current that will run one or two small lamps. 2. Can I procure a number of your paper in which there is given a description and illustration of a plunging bichromate battery? A. We shall at an early day publish a description of a plunging battery.

### TO INVENTORS.

An experience of forty years, and the preparation of more than one hundred thousand applications for patents at home and abroad enable us to understand the laws and practice on both continents, and to possess unequaled facilities for procuring patents everywhere. foreign countries may be had on application, and persons contemplating the securing of patents, either at home of abroad, are invited to write to this office for prices, which are low, in accordance with the times and our extensive facilities for conducting the busines MUNN & CO., office SCIENTIFIC ARRESTOAN, 261 Broad-

# INDEX OF INVENTIONS Cultivator, E. Bast.

#### For which Letters Patent of the United States were Granted

#### April 10, 1888.

April 10, 1888,		Di
AND EACH BEARING THAT DA	ATE.	Di Do
[See note at end of list about copies of these pat	ents.]	Dı
Advertising rack, I. H. Randall		Di Di Dy
Alto rilievo ornamentation, roller for producing, I H. Thaison	380,833	D <sub>2</sub>
Animals, machine for grooming, N. Petersen  Auger, spoke, S. B. Shaffer	860,924	D <sub>1</sub> D <sub>2</sub> E <sub>6</sub>
Axle, wagon, N. L. Holmes	380,794	E)
Bagasse drier and furnace, A. G. De Aguiar Bagasse furnace, F. Cook	380,999	EI EI
Ballot box, registering and caceling, A. Bigel-	381,071 380,810	El
man Barber's chair, E. Melchior Bark stripping machine, willow, J. Schildhauer	380,909	El
Barrel making machine, M. E. Beasley et al	381,077 380,976	El El
Barrel making machine, G. Rehfuss et at Battery. See Galvanic battery. Secondary battery.		El El
Batteries, construction of stationary and itine- rant electrical, J. T. Armstrong	380.971	El El Er
Bed spring, C. W. Donnell	381,060 380,696	Er
Belts, compound oil dressing for rubber, G. W. Cooper Bicycle, C. F. Hadley	380,993	Er Er Ez
Bill holder, H. E. Leasure	380,685 381,092	Ey
Blinds, blind rod for sliding, G. Poppert Boats, etc., releasing device for, J. L. Cathcart	380,930 380,786	Fa Fa
Boiler, W. E. Dean	381,082	Fe Fe
Bollers, junction piecs for steam, G. S. Strong Bolt, G. D. Murdoch	381,039	Fe Fi
Bolts, machine for cutting the threads on, W. S. Halsey		Fi Fi
Bolts, nuts, etc., machine for shaving heads of, H. Minter Bolting reel, O. M. Morse	380,917	Fi Fi
Book signatures, machine for gathering and collating, S. E. Johns	380,898	Fla Fla
Boot protector, felt, Saunders & Rauch	380,715	Flo
Boots and shoes, rack for holding, S. L. Saunders. Boots or shoes, button piece for, A. Shea	380,938	Fo
Bottle, nursing, W. F. Ware	380,967	Fo
Bottles, screw stopper for, Barrett & Varley  Bowls, making wooden, J. Berkey  Box. See Ballot box. Paper box.	380,782 380,742	Fo Fr
Brake. See Car brake. Wagon brake. Brake lock, A. Hansen	381,010 ·	Fu
Bridge, swing, C. W. Martin	380,906 380,966	
Bung and air vent, A. Pape,		Ga Ga
Butter worker, F. E. Crawford	380.678	Ga Ga
Button fly marking machine, H. R. Corkhill, Sr Button forming machine, R. Hormann Button making machine, F. Bocks	380,722	Ga Ga
Button setting machine, F. H. Richards381,080, Buttons, manufacture of, D. A. Ladd	381,081	Ga
Cabinet case for holding railway folders, G. A. Fellows		Ga
Can body making machines, feeder for, J. Stev-	<b>3</b> 60,836	Ga
ens		Gla
Robinson	381,084	Gr Gr
Car coupling, J. V. D. Eldredge	380,684	Gu
Car coupling, H. Sabine	880,936	Gu Gu
Car platform, T. W. Moore	380,705	Gu Gu
Car, stock, C. Langguth	380,725	Ha Ha
Carrier. See Cash carrier. Sheaf carrier. Cartridge, G. M. Peters	380,689	Ha Ha
Case. See Cabinet case. Show case. Cash carrier, L. J. Bishop Cash carrier apparatus, J. F. Burdett		Ha
Cash register and indicator, E. T. Taylor Caster rollers, manufacturing, R. B. Codling	380,831 380,790	He
Casting ordnance, apparatus for, R. J. Gatling Casting pattern, F. M. Stevens Chair. See Barber's chair. Dental chair.		Ho
Chisel gauge, C. L. Mead	380,811	Ho
Newbery & Vautin	380,988	H <sub>3</sub>
Churn cover, J. H. Taylor	380,832 ] 380,753 ]	Ice
Cigar bunching machine, J. R. Williams	380,969	
Clock movement, A. E. Hotchkiss (r)	380,963	
Clothes drier, O. M. Shannon	381,074	
Coloring matters, production of diazoic, Poirrier & Roussin	<b>360.92</b> 8	Iro
Colors, production of azo, Poirrier & Rosentiehl Combination lock, H. C. Griffin	380,927	Iro Ki
Coping, metallic socket connection for stone, W. Williams	380,71 <b>0</b> 380,7 <b>67</b>	K
Corner iron, J. Doty	880,871	La
Coupling. See Belt coupling. Car coupling. Pipe		La

Cultivator, E. EastCultivator, J. Shank	380,948
Curtain pole, J. Rings	881,041
Cut-off, automatic, W. G. Browne Cutter. See Feed cutter. Tube cutter.	-
Dental chair, L. Stuck  Dentifrice, J. Schwartz	
Die. See Screw cutting die. Die grinding mechanism, M. Brock	380,985
Digger. See Potato digger.  Doors, mechanism for operating sliding,	
Peirce	. J.
Crane	
Drier. See Bagasse drier. Clothes drier. Dyestuff, manufacture of purple-black azo,	
Witt	381,046
Dyeing apparatus, U. Weldon Dynamo, H. B. Slater	
Egg cases, making, E. L. Walker Ejector, J. M. Marty	
Electric accumulator, J. W. Pendleton  Electric cut-out, Perkins & Tregoning	380,765
Electric indicator, O. B. Shallenberger Electrical distribution, alternate current sy	380,942
of, Byllesby & Shallenberger Electrical distribution, central station for a	381,064
nate current systems of, Shallenberger &	Byl-
lesby Electrical distribution, system of, Hart  G	ood-
fellow Electrical governor, F. E. Prichard	390,817
Electrical hand cord tip. H. J. Swarts Electrical indicator, O. B. Shallenberger	
Electrical translation, system of, R. Belfield,	0,845, 380,846
Electrode for secondary batteries, R. Packer Elevator alarm, J. W. Holdsworth	380,922
Embossing wood or other material, machine B. Ludwig	for,
End gate, J. Cunningham	381,057
Engine. See Steam engine.  Extractor. See Rivet extractor.	002,010
Eye bars, machine for upsetting, Cooke &	
Fan, rotary, R. B. Cissel	\$60,788
Fastening device, Carter & Louther	380,966
Felt or felted articles, steam box used in mai	381,012
Fence, F. E. Wood	
Files, machine for cutting, C. M. Fairbanks Filter, water, H. W. Grelle	
Firearm, breech-loading, F. G. D. Holmes Fire extinguishing apparatus, locomotive, l	380,682
Truesdell	380,956
Floor, roof, or area covering, P. H. Jackson (see Flour dresser, B. Kniffler	r) 10,921
Flushing tank, pneumatic, J. E. Boyle	
	1,064, 381,065
Folding and swinging gate, J. B. & G. Goodwi Forgings, appliance for manipulating large	, G.
Siddell	
Fork guard. F. C. Felcker Frame. See Pocketbook frame, Furnace. See Bagasse furnace. Boller furn	880,798
Fork guard. F. C. Felcker	390,798 18.06.
Fork guard. F. C. Felcker	380,798 nace. 380,741 nuge.
Fork guard. F. C. Felcker Frame. See Pocketbook frame, Furnace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	380,798  DECC 380,741  DUGC.
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	380,798  nace 380,741  nage. nage. 0,855, 380,856 380,951 380,802
Fork guard. F. C. Felcker. Frame. See Pocketbook frame. Furnace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey. Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker. Frame. See Pocketbook frame, Furnace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey. Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frame. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frame. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ge Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker. Frame. See Pocketbook frame. Frunace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey. Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ge Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ge Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine gs Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ge Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine gs Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ge Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagasse furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker. Frame. See Pocketbook frame. Frunace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey. Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer.  38 Garment clasp, D. L. & A. D. Smith Gas burner, regulator, W. M. Jackson. Gas burner, regulator, W. M. Jackson. Gas burner, c. H. Miller. Gas governor, automatic, F. Bredel. Gas mains, water trap for, A. Chambers. Gas pipes, apparatus for cleaning charged McGee.  Gas works, hydraulic main for, McIlhenn Lansden. Gate. See End gate. Folding and swinging a Swinging gate. Gate, G. Ford. Gearing, H. Holloway. Glove, fastening, E. Pringle Grain binder, M. L. Nichols Grain binding machines, bundle ejecting mec ism for, M. A. Keller. Guard. See Fork guard. Gun barrel, cane, E. D. Bean. Gun, breech-loading, L. H. Smith Gun training apparatus, J. Vavasseur. Guns, apparatus for loading heavy, C. H. Mu Gunpowder or analogous materals, compres W. Lorenz. Hammer, drop, F. M. Leavitt. Hammocks, etc., frame work for, W. F. Parm Hanger. See Umbrella hanger. Harvester, grain binding, M. L. Nichols Hat or bonnet holder for tables and wardre V. M. Hollyday. Hay press, Gorrell & Tubbs. Hat or bonnet holder for tables and wardre V. M. Hollyday. Hay press, Gorrell & Tubbs. Heating furnace, E. W. Anthony. Holsting tackie, S. M. Vauclain. Holder. See Bag holder. Bill holder. Pi sham holder. Rein holder. Hook. See Snap hook. Hook, G. C. Beals. Horseehoe, I. G. Howell. Hydraulic elevator mechanism, E. B. Benhan Hydrogen, making, Majert & Richter. Ice creeper, W. W. & E. F. Preston. Lee shaving machine, R. H. & D. L. Bates Inhaler, J. B. Henry. Indicator. See Electric indicator. Electrica dicator. Pressure indicator. Speed cator. Inductive resistance, adjustable, O. B. Sha berger. Iron, see Corner iron. Sad iron. Iron and steel, apparatus for manufacturing of pound plates of, A. Wilson. Iron, manufacture of planished sheet, W. & W. Rogers.  Kild. See Surgical knife.	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine gs Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Furnace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	
Fork guard. F. C. Felcker Frame. See Pocketbook frame. Frunace. See Bagase furnace. Boller furn Heating furnace. Furniture, article of, J. Berkey Gauge. See Chisel gauge. Machine ga Planergauge. Surface gauge. Water ga Galvanic battery, H. J. Brewer	

Croshing mill. A. B. Roe. ...... 80.821

200	~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~	
Lamp extinguisher, W. M. Greene. 380,885	Sewing bags, machine for, L. Bollmann	30,981
Lasting machine, C. H. Kelley	Sewing comfortables and other fabrics, machine for, F. L. Palmer	
Lathes, shelf for wire nettings for, H. T. Clawson 380,789 Leather creasing machine, S. H. Randall 381,029 Leather, machine for splitting scrap, J. A. Jos-	Sewing machine presser foot, D. A. Sutherland 38 Sewing machines, hand propelling device for, K. P. Beaird	· 1
selyn	Shackle, Ferrell & Israel	
Lime kiln, J. H. Wallstrom	Kelly	
bag lock. Nut lock. Locomotive, electric, S. D. Field	Shelf, revolving, C. Jewell	
Locomotor, electric, S. D. Field	Shoe upper turning machine, F. D. Walden 38 Show case for entomological and other specimens,	90,959
Looms, shuttle holder attachment for, W. Wattie 380,736  Machine gauge, G. C. James	C. F. McGlashan	
Mail bag lock, J. C. Brown       380,986         Mattress, sectional, N. Clement       380,718	Shutter fastener, J. A. Bachman	30,738
Measuring machine, automatic grain, A. J. Grissom	Sled, child's. Pratt & Chase.         38           Sleigh, N. G. Reynolds.         38	
Mecbanical movement, G. Schenck	Snap hook, Crippen & King	
Meter, See Rotary liquid meter.  Microphone transmitter, G. M. Phelps 380,925	Snow, rotary excavator for removing, E. Leslie 38 Soda water dispensing apparatus, O. J. Price 38	
Mill. See Coffee mill. Crushing mill. Roller mill.	Sodium, etc., apparatus for obtaining, O. M. Thowless	
Mortising, tenoning, and planing machine, and turning lathe, combined, E. W. Snedeker 380,358	Sodium, etc., obtaining, O. M. Thowless	30.745
Motor. See Multiple cylinder motor.  Mowing machine divider, J. H. Jones	Speed governor for motors. E. B. Benham 38 Speed indicator, electrical, F. W. Schlepegrell 38	
Multiple cylinder motor, E. B. Benham	Spinning machines, etc., spindle driving device for, L. Binns	
Nail making and distributing machine, F. F. Raymond, 2d	Spinning mule, W. Hackaley	
Needle and cord, combined, F. A. Smith, Jr 380,773 Nest, hen's, E. M. Schmacher	Square, bevel, and clinometer, combined center, T and try, H. W. Evans	SD.714
for forming sheets of, M. G. Farmer	Steam engine, W. F. Class. 33 Steam engine, E. S. Smith 33	80,991
Nut lock, J. H. Piper         380,926           Oils, etc., package for, C. S. Homer         390,894	Steam engine indicator attachment, J. R. Mitchell	
Operating table and desk, surgeon's combined, F. L. Cowles	Steam trap, G. Dinkel	80.791
Ore pulverizer, Baratini & Stevenson	Stone, artificial, O. A. Tanner	
Hickies	Stove, gas, Smith & Boyd	
Paint, waterproof, M. Fred       380,795         Paper box, K. J. Collins       380,861	Stove, heating, Walker & Wilbur	81,096
Paper box, C. W. Elliott	Strainer, conductor, P. Drendul	
Parer, apple, F. R. Williams	Surgical knife, W. Schott	
Pegging machine, E. E. Bean	Switch. See Railway switch. Safety switch. Switch and signal, interlocking, J. J. Turner 3	
Photographic image on a gelatine surface into a relief or intaglio, converting a. H. Sutton 381,091	Syringe, C. M. Barton	.
Picture exhibitor, A. H. Beck         380,977           Pillow sham holder, W. Watson         380,964	Tan vat, J. Head	.
Pin. See Safety pin. Pipe. See Stove pipe.	Tanning, Warter & Koegel	Ì
Pipe coupling, flexible, J. H. Gould	for, A. M. Burritt	
Saunders	ton	80,778
Pitman and crank connection, E. B. Benham	Telegraph, muncipal, J. C. Wilson	80,780
Planter and fertilizer distributer, combined, J.  M. Pope	Telephone transmitter, I. H. Farnham	
Planter, corn, G. D. Haworth         380,889           Planter, corn, A. S. & E. Houck         381,073	ton	
Planter, corn, Kocher & Ranck         381,076           Planter, cotton, J. R. White         380,841	Thermometer, recording, D. Draper 3	
Planter, cotton seed, B. D. & J. B. King	Timbers, preserving submerged, H. L. Ricks	
Planters, attachment, for corn, W. H. Stevens 381,036 Platform. See Car platform.	Toboggan, Emerson & Wetmore	
Plow, A. M. Nash	Track buffer, R. P. Garsed	
Plow, gang, H. M. Irwin       380,895         Plow standard. W. H. Hodgson       881,014	Tricycle, H. W. Schiermeyer 3	80,770
Pocket book frame, B. Vom Eigen         380,834           Potato digger, A. B. Shants         380,771	Williams 3	
Press. See Baling press. Hay press. Pressure indicator, election, O. B. Shallenberger 380,944		381,069
Propeller, feathering, R. Wilcox	Tug, hame, C. A. Kupfer	380,903
tector. Pulleys, clutch for band, W. H. Smith	Type writing machine, A. P. Eggis	380,996
Pumping apparatus, horse power, H. D. White 380,840 Rack. See Advertising rack.		380,862
Railway crossing, J. Cumming	Valve for multiple cylinder engines, E. B. Ben-	
Railway grip, cable, A. E. Roe       381,032         Railway signal, W. B. Sherman       381,096	Valve gear, releasing, C. A. Dixon	381,001
Railway switch, W. S. Arnold         380,972           Railway tie, metallic, W. H. Donaldson         381,069	Valve, steam-actuated, W. W. Hanscom 3	380,888
Railways, contact making device for electric, F.  Wynne	Valves and other mechanisms, device for operat-	
Rake. See Rice rake. Reel. See Bolting reel.	Valves, cut-off mechanism for slide, Tangye & Johnson, Jr	380 <b>.95</b> 5
Register. See Cash register. Regulator. See Gas burner regulator.	Vat. See Tan vat. Vehicle, passenger, R. A. Morse	
Rein holder, E. E. Brewster	Vehicle wheel, J. Blais	380,852
Gardner 380,883 Rivet extractor, P. Snitzel 380,703	Velocipede, C. F. Stillman	381,038
Roads, machine for making, repairing, and clearing, G. W. Taft	1	380,853
Roller mill, P. Ferrier	Volt ammeter, O. B. Shallenberger	380,943
Roofing felt, manufacture of, H. M. Miner	Wagon brake, automatic, J. H. Fisher	<b>380,754</b>
Rotary liquid meter, W. E. Pearson		
Stevens         381,035           Sad iron, Gilmore & Stafford         381,006	ing the, J. B. Determann	381,000
Safe, burglar-proof, M. S. Goldsmith       380,717         Safety pin, J. Jenkins       380,896		
Safety switch, St. Cyr & McDonald       881,084         Sash balance, T. Jones       380,806		
Sash cord fastener, J. H. Jones       381,016         Saw guide, G. F. Striegel       380,826		
Sawmill dog, J. H. Miner	Water gauge, alarm, Fisher & Rappold	
Saw tooth, E. Harris	Piper	
M. Covel	Weatherstrip for cardoors, E. R. Stiles	381,037
Scale, automatic weighing and recording, E. H. Amet	, , ,	
Scale beam, A. H. Smith	Windlass, H. F. Crandall	
Sealing fruit jars, device for, W. W. Osmond	Wire band, spring, J. Jackson	<b>3</b> 81,017
Seed hulling machines, cylinder for cotton, A. D. Catlin	Wire gripper, B. Erbe	380,749
Separator, A. Wemple		

	Wire rope lines, rail for elevated, A. Bleichert	380,984
	Wire stretcher, B. Erbe	380,750
,	Wrench, M. E. Campfield	380,859
	Wrench, W. L. Tobey	380,735
	Yarn, balance apparatus for ascertaining counts or numbers of, E. Staub.	
	or numbers of, E. Staub	380,826
,		
	1	

#### DESIGNS.

Badge for hats, C. J. Heller	18,249
Box, Hamborg & Weding	18,248
Certificate, business, C. S. Garney	18,247
Cord, L. Binns	18,244
Costume, lady's, H. F. Duke18,245,	18,246
Costume, lady's, M. Kent	18,252
Costume, Miss', L. Soderholm	18,256
Gown, lady's tea, J. Sheils	18,255
Range, cooking, Schermerhorn & Weller	18,254
Stove. cooking, Keep & Wipfler	18,251
Stove, gas or vapor, C. A. & L. Stockstrom18,257,	18,258
Trimming, B. Lipper	18,253
Type, C. E. Heyer	18,250

;	TRADE MARKS.	
,	Beer, V. Blatz	15,349
•	Bitters and blood tonic, pulmonary, B. A. Scotte	15,356
1	Canned tomatoes, Starr & Bro	15,358
ŀ	Hosiery. O. Heinze & Co	
ĺ	Medical tea, D. Back & Co	<b>15,34</b> 8
1	Medicine and lung healer, pulmonary, D. F. Pow-	
,	ell	15,855
١,	Paper, toilet and wlapping, Albany Perforated	
	Wrapping Paper Company	15,347
. !	Pharmaceutical and medical preparations gene-	
	rally, B. Fragner	15,350
	Rubber mats, New York Belting and Packing	
•	Company	
3	Sauces, table, D. Warren	15,359
•	Staples and goods united by such staples, metallic,	
,	Acme Staple and Machine Company	15,346
,	Tonic nutrient beverage, Phillip Best Brewing	
,	Company	
,	Type writing machines, Standard Type Writer	
3	Manufacturing Company	
,	Wines, A. Kreiser	15,852
,	I .	

A printed copy of the specification and drawing of any patent in the foregoing list will be furnished from this office for 25 cents. In ordering please state the name and number of the patent desired, and remit to Munn & Co., 361 Broadway, New York.

Canadian Patenta may now be obtained by the inventors for any of t. Prentions named in the foregoing list, provided they are simple, at a cost of \$40 each. If complicated the cost will be a little more. For full instructions address Munn & Co., 361 Broadway, New York. Other foreign patents may also be obtained.

### Mdvertisements.

Inside Page, each insertion - - - 75 cents a line. Back Page, each insertion - - - \$1.00 a line. The above are charges per agate line—about eight words per line. This notice shows the width of the line, and is set in agate type. Engravings may head advertisement at the same rate per agate line, by measurement, as the letter press. Advertisements must be received at publication office as early as Thursday morning to a pear in next issue.



SYSTEMS OF DISTRIBUTION OF SISTEMS OF DISTRIBUTION OF Electricity.—A lecture by Ellin Thomson, delivered in the Sibley College course. The series multiple arc. series multiple and multiple series, accumulator and induction systems described, and their advantages and disadvantages discussed. With 18 figures. Contained in SCINNIFIC AMERICAN SUPPLEMENT, No. 603. Price Weents. To be had at this office, and from all newsdealers.



Wells, Oil and Gas Wells, drilled by contract to any depth, from 6t to 5000 feet. We also manufacture and furnish everything required to drull and complete same. Portable Horse Power and Mounted Steam Drilling Machines for 100 to 600 ft. Send Geents for illustrated catalogue.

PierceWellExcavatorCo.

New York.

LIGHTNING CONDUCTORS.—DESCRIPtion of a new form of apparatus for testing lightning conductors, and the method of using it. Illustrated with 8 engravings. Contained in SCIENTIFIC AMERICAN SUPPLEMENT, NO. 596. Frice 10 cents. To be had at this office and from all newsdealers.

## DELAFIELD'S PAT. SAW CLAMP

With saw for cutting metals. Saves all the broken hack-saw blades. In use over two years in all parts of the country. The new clamps have the edges bevelled that hold the saw. By mall, with one blade, 50 cents. Extrablades 8%" x"." Star." 7 cents each, 70 cents per dozen by mail. Blades 8" x 1", "8 tubs," 35 cents each, by mail. Discount to dealers. by mail. Discount to dealers.
NOROTON MFG. WORKS, Noroton, Conn.

NOROTON MFG. WORKS, Novoton, Conn.

ON RED AND PURPLE CHLORIDE, brumide and lodide of silver.—On Heliochromy, and on the latent photographic image. By M. Carey Lus. A series of papers showing (1) that chloring, bromine and lodine are capable of forming silver compounds exhibiting beautiful colorations and possessing great stability; (2) that of these substances, the red chloride shows a tendency to a reproduction of colors; and (3) that these substances constitute the actual material of invisible photographic images, and that such material may now be obtained by the ishoratory without the aid of light. Contained in ACIRVITIC AMERICAN Superposed and from all newsdealers. To be had at this office and from all newsdealers.



STEAM and ELECTRIC LAUNCHES,
Pleasure Boats, Sailing Canoes,
Prodding Canoes, Oars, Roulacks,
Sails, etc. 80 page catalogue.
Over seventy-five illustrations.
Send 5 cents. None free. Mention the Scientific American.
J. H. RUSHTON,
Canton, N. Y.

HYPNOTISM IN FRANCE.—AN INteresting review of the present status of this subject, by Max Dessoir. Contained in Scientific American Supplement, No. 613. Price 10 cents. To be had at this office and from all newsdealers.

# The Draper Recording Thermometer.



This thermometer gives a permanent and continuous record in ink of the temperature. The chart indicating hours of the day and days of the week gives the degrees of temperature from 20 below zero to 110 above. All instruments are accurately adjusted and warranted. The record is easily read and absolutely correct. Sold by the leading instrument dealers and opticians throughout the United States and Canada, and by

The DRAPER MANUFACTURING CO. Thermometer.

Owners of the United States and foreign patents, 152 Front Street, New York Copyrighted.

THE NEW CROTON AQUEDUCT.— THE NEW CROTON AQUEDUCT.—
Detailed description of the great aqueduct now being constructed to increase the water supply of New York (ity, and also of the great dam which it is proposed to build across the Croton River, at Quaker Bridge. With engravings and a map. Contained in SCIENTIFIC AMERICAN SUPPLEMENT, No. 55S. Price 10 cents. To be had at this office and from all newsdealers.

# Specimen Professional Testimony.

St. Louis' Well Known Dentist, Dr. Flickinger, testifies: "I shall henceforth strongly advocate the use of the



being fully convinced that it is the only article in market which acts in conjunction with floss silk, both as a thorough cleanser and efficacions absorber of the acids and accumulations on and around the teeth."

18 Economy. Holder (imperishable) 35 cents. "Felts" only need be renewed. Is (boxed) 25 cents, each pleasantly lasting 10 days. Dealers or mailed.

HODERY MEC. CO. ""."

HORSEY MFG. CO., Utica, N. Y.

GAS ENGINEERING, RECENT PROgress In.—By A. Macpherson. Regenerative system of retort firing. Improvements in gas purification. Burners and regenerative lamps. The Weisbach gas light, Paraffin as a rival of coalgas, oil in gas making. Prices of residual products. Contained in SCIENTIFIC AMERICAN SUPPLEMENT, NO. 601. Price 10 cent. 10 be had at this office and from all newsdealers.



#### Steam! Steam!

We build Automatic Engines from 2 to 200 H. P., equal to anything in market.


A Large Lot of 2, 3 and 4-H. Engines With or without boilers, low for cash.

B. W. PAYNE & SONS,

Box 15.

Elmira, N. Y.

LIMITING NUMBERS OF TEETH IN Gear Wheels.—A valuable paper by George B. Grant treating of the different methods of determining the limiting numbers of teeth in gear wheels when small pinions must be used. The cycloidal system. The interchangeable volute system. The non-interchangeable volute system. The non-interchangeable volute system. With II figures. Contained in the SCIENTIFIC AMERICAN SUPPLEMENT, NO. 592. Price 10 cents. To be had at this office and from all newsdealers. LIMITING NUMBERS OF TEETH IN

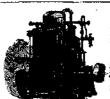

For Printers, Steam Tachts, pumping water, saving wood, making lee-cream, Carpenters, Mechanics. It of H. P., Fuel, Kerosene. No disst. Automatic in fuel and water supply. Illustrated Catalogue free. Mention Scient Tipic American.

SHIPMAN ENGINE CO.

# To Business Men.

The value of the SCIENTIFIC AMERICAN as an advertising medium cannot be overestimated. Its circulation is many times greater than that of any similar journal now published. It goes into all the States and "arritories, and is read in all the principal libraries and reading rooms of the world. A business man wants something more than to see his advertisement in a printed newspaper. He wants circulation. This he has when he advertises in the SCIENTIFIC AMERICAN. And do not let the advertising agent influence you to substitute some other paper for the SCIENTIFIC AMERICAN, when selecting a list of publications in wanca you decide at is for your interest to advertise. This is frequently done, for the reason tast the agent gets a larger commission from the papers having a small circulation than is allowed on the SCIENTIFIC AMERICAN.

For rates see top of first column of this page, or address

MUNN & CO., Publishers,

MUNN & CO., Publishers, 361 Broadway, New York.



Stationary Engines with Plain and Automatic Cut-off. Vertical and Herizental.

Penna. Diamond Drill Co., Birdsboro, Pa.

# SCIENTIFIC BOOK CATALOGUE,

RECENTLY PUBLISHED.

Our new catalogue containing over 100 pages, including works on more than fifty different subjects. Will be mailed free to any address on application.

MUNN & CO., Publishers Scientific American, 361 Broadway, New York.

JOHN G. ROLLINS & Co., Limited, London, England, an old established and reliable House, are well situated to represent American Manufacturers in the sale of their products in Foreign Countries. Satisfactory American and English reference if required. Address direct, or American Office, 4 Stone Street, New York City.

