has been long in use, of which the navigation of the iron paint mixed with boiled linseed oil, two coats, dry Schuylkill River, from Philadelphia to Pottsville, is a each in the sun, or if you desire a fine finish use Japan notable example. The Sault Ste. Mary Canal is also an baking varnish of any dark color and bake in an oven example. Tide locks have also been long used in the at about 260° temperature. United States for ordinary canal purposes, and in England for the largest ships. 2. Is there any geographical reason why such locks could not be built in the mouth of the James River, at some suitable place above Newport News, and thus form a motionless level of over 100 miles, and gain at least 4 ft. of water as against low tide? A. There is no reason that we know of to prevent the James River being made navigable by water, except the rights of riparian owners. 3. What is an approximate estimate of miles of navigable streams in this country, that could be so improved? There are thousands of miles of streams in the United States that could thus be made navigable as well as a source of power. Railroad competition seems now to be a bar to this class of improvements.

(3841) N. M. W. asks: 1. What size and quantity of silk covered magnet wire should be used on a Bell telephone, and to what resistance wound? A. Use enough No. 36 wire to bring the resist ance up to 150 ohms. 2. Would No. 32 cotton covered do, and what amount of it, and resistance? A. No. 32 will not answer so well. 3. What number in American or Brown and Sharp gauge corresponds to No. 36 B. W. G, which I have been told to use on my telephones? A. No. 35 American gauge corresponds to No. 36 Birmingham gauge. 4. I have some 3 in. by 6 in. steel magnets, very strong. Are they of proper size? A. Yes. 5. My diaphragms are of common tintype plate. of diaphragms, 21/6 in.; diameter of speaking hole, 136 in. How far from end of magnet should diaphragm diaphragms. You can get thin tintype plates from dealers in photographic supplies. 6. What dimensions are best for bobbin? Distance from diaphragm to bottom of box about six or seven-eighths of an inch A. It is not very material. Consult SUPPLEMENT, No. 140. 7. What has become of the "House" telephone, which you described in the Scientific American some years ago? I think you stated that it would be put on the market. A. We do not know that anything is being done with it. 8. How long a line could be operated with above telephone, without battery, and if battery were used, of what kind should it be, and how 15 connected? A. On a line unaffected by induction, you can probably secure fair results for a distance of from two to three miles. 9. When size of wire is given, without specifying, is the American gauge implied? A. Yes. 10. I have some one quart bichromate of potassa batteries, and some of the carbons are broken. and I wish to replace them myself. They are fixed in brass plates, which have raised pieces running across them on each side of carbon. The carbon seems to be fastened in with lead. Please tell me how it is done. Carbons 1% by 6 in. A. The lead is cast upon the ends of the carbons.

(3842) C. B. says: Can you tell me how to clean brass rifle shell so that they can be reloaded? When I try to clean them with soda it forms a corrosive substance on the inside and outside. A. The corrosivesubstance was on the shells at first. the soda only dissolving the acid portions. Try a solution of oxalic acid in hot water for a few minutes; after washing with soda, wipe inside and outside with a swab on a stick and finish with a soda wash.

(3843) M. S. asks: 1. Can 1 get the same amount of power from the simple electric motor, page 498," Experimental Science," with 6 cells of Fuller battery, as I could if it was made so small as to give its maximum amount of power with 6 F. cells? A. You can always secure the best results by baving the motor proportioned to the battery. 2. How much smaller would it have to be made, also how much and what sizes of wire should be used? A. Make the motor about half the size given, and wind it with No. 20 and diameter of core, size and amount of wire for wire. 3. In either case would the 6 cells develop enough power to run a sewing machine? If not, how many would? A. No; six cells of Fuller battery will not run a sewing machine. It will require double that number. 4. How can I, when using Fuller cells cause the motor to run fast or slow, as when running a sewing machine? A. You can vary the speed of the motor by introducing resistance into the circuit or removing it therefrom. 5. My Fuller battery has been set up two weeks and the zincs, which are Leclanche battery zincs, are just about and higher amperage, capable of heating the carbon filaused up. They were amaigamated and the ends immersed in mercury in the porous cups, which are second hand Leclanche porous cups. The solution used was a saturated solution of bichromate of potass, with 10 per cent of sulphuric acid outside porous cup, water inside. 'The work done by the battery during that time was to light a four candle power lamp one hour and a quarter and to light gas. Shouldn't the zincs have lasted of the zincs? A. Leclanche zincs are too small for the pounds each. Use pure zincs and plenty of mercury.

(3844) J. M. says: 1. Suppose a pound of lead and the same weight of wood were dropped from a height of two hundred feet at the same instant, how much difference would there be when the lead reached the ground? If a piece of lead and a piece of wood the same size were dropped from the same height at the same instant would there be any difference between them or would one reach the ground before the other? A. There will be a very great difference in the first case,

out to sea? A. The slack water navigation of streams | tain rain water? A. Paint the pail with red oxide of

(3846) W. F. B. asks: 1. Can a low pres sure engine be worked with success receiving steam direct from high pressure engine without steam jacket? A. The two engines as described can be run as a compound engine if properly arranged. 2. What would be the horse power of a compound engine, high pressure cylinder 16×24 in., low pressure 24×24 in., speed of engine 100 revolutions per minute, steam pressure 150 pounds? A. They should develop from 400 to 450 horse power. 3. What is the width of a locomotive fire box and water space when such is inside of frame? A. Width of fire box, about 4 feet 4 inches; water space of legs, 4 inches.

(3847) S. A. K. says: I have 15 nounds of water at a temperature of 60° Fah., and add 2 pounds of steam. What will be the temperature of the mixture? Would there be any difference if I add the same quantity of boiling water instead of the steam? If so, why? A. As you do not mention the pressure of steam, which makes some difference in the result, we assume 5 pounds pressure, which will give you a temperature of 205°, while with boiling water the temperature of the mixture will be but 80°. With steam you add the latent heat of steam, or 950° for each pound of steam

(3848) J. L. Can l constructa battery which will generate electricity enough to supply three incandescent lights, and also how many cells and Is this proper, or should they be thinner? Diameter what size will I have to use? A. It depends entirely upon the size of the incandescent lights. You can run three or six 20 volt lamps with 11 cells of storage batbe placed? Where can I get very thin iron or steel tery, and you can charge the storage battery with for diaphragms? A. Tintype plates will answer for gravity batteries, using four cells of gravity to each cell of storage. We do not advocate the use of primary batteries for practical electric lighting.

> (3849) H. asks: 1. What pressure per square inch would air have if reduced ½ its volume at sea level, to 14, to 14? A. 15 pounds, 45 pounds, 105 pounds. 2. Give formula to find pressure at various stages of compression. A. For isothermal compression

V-P=gauge pressure. P=absolute the formula is

 $\frac{15}{2}$ -15=15 pounds gauge pressure

and $\frac{19}{4}$ -15=105 pounds gauge pressure.

(3850) D. C. S. says: Being an old subscriber to the Scientific American, I would like to ask your opinion in regard to the use of a steam boiler in use here: the boiler in question is of steel plate. % inch thick, 12 feet long, 60 in. diameter, with thirty-nine 3 inch tubes, return, and the take-up is over the furnace doors, and has the old style safety valve with a round iron ball as weight on lever arm. The proprietors when ready to start found the engine unable to drive the mill with the weight at the end of safety valve lever, and so they added a 56 pound pea to same, and yet had to add 4 fire bricks to end of lever before the pressure was able to drive the mill. Some claim this to be dangerous, as the ball weight on end of lever is the full capacity of boiler; with all this weight, the steam gauge only shows 100 lb. pressure, and is all the time giving trouble by leaking, etc., and needing repairs, etc. A. This is an example of the daugerous practices resorted to in order to get more work from a boiler than is due to its safe capacity. The very fact of its leaking at 100 lb. pres sure shows that it is overstrained. This is the cause of many boiler explosions, and should not be tolerated by engineers.

(3851) J. F. asks if an induction coil can be made with which to light a 16 candle power Edison's incandescent lamp. If so, please give length primary and secondary coils, and number of layers of each. Have 40 jars gravity battery which can be used to furnish primary current. A. An ordinary induction coil will not light an incandescent lamp, as the secondary current generated by such a coil is of very high E. M. F. with low amperage. The induction coils used for operating incandescent lamps, and known as trans formers, are designed for converting a current of high E. M. F. and low amperage, into a current of low E. M. F ments of the lamps to incandescence. The only way you can utilize your gravity batteries for electric lighting is to use them for charging a secondary battery, employing the latter for operating your lamps. With foreign countries may be had on application, and persons your 40 jars you can charge 10 cells of secondary bat-

(3852) W. F. C. writes: I have a magazine clipping which I wish to separate, so as to paste longer? And can you suggest a remedy for the wasting both sides in a scrap book. Is there any way to split it and not destroy the paper? A. Cover both sides of Fuller battery. The zincs should weigh from 1 to 2 the clipping with strong paste, and insert it between two pieces of very strong, smooth paper, making sure to have it attached by every portion of its surface to the pieces of paper. Allow it to dry thoroughly, then pull the stout papers apart; this will split the clipping, and the parts may be soaked off, washed, and pasted in the scrap book.

(3853) W. A. B. asks: 1. Can you give me a good remedy for a sprained wrist? I have tried several remedies, such as liniments, arnica and a band around the wrist, but without cure. A. After the reme-

Will they last longer if painted? A. The cost increases in the order named. Copper gutters will outlast tin or galvanized iron many times. All will last longer by being painted every two years. The comparative cost will depend on the thickness of the metal.

(3855) W. J. says: Our old grist mill: had fruns of stones. These stones were 48 inches diameter and ran 160 revolutions per minute, making a fine quality flour. What amount of power would each stone require? How many bushels of wheat should be ground per stone, or what should be the output of the mill in bushels of wheat ground and in barrels of flour, for one day or twenty four hours? A. Each stone will require 416 horse power, and should grind 416 bushels wheat per hour, making a total output of 648 bushels per day of twenty-four hours, with 27 horse power. This does not include power for elevating and bolting, which will require about 4 horse power.

(3856) J. E. L. says: Could you inform me (a subscriber) what is the trouble in regard to the successful operation of a compressed air motor? Is it caused by the friction of the valves, pistons, etc., and the lubricating of the same, as this might be difficult? have thought it might prevent their successful operation. In steam and water engines this is not necessary, viz , lubricating to a great extent, that is, of the parts mentioned. A. Compressed air motors are in successful use in Europe for power purposes, and compressed air is used all over the world for running rock-drilling machinery and pumps in mines. There is no difficulty in their use. See Scientific American Supplement, Nos. 765, 721, 684, on the use of compressed air for

(3857) J. H. S. asks: 1. What temperature of air passing through petroleum is necessary to vaporize it? A. Crude petroleum may begin to evolve vapor at 100° F, or less, all depending on the sample. To finish the volatilization a high temperature is needed at the end, and some pitch will be left in the still. 2. What is the highest temperature petroleum gas will stand without ignition, mixed and unmixed, with the proper quantity of air for complete combustion? A. 1,000° to 1,500° F. 3. What heat does petroleum gas produce in burning? A. It depends on the gas or the burner. Theoretically, it might give 4,000° to 5,000° F. Actually, not over half these temperatures should be looked for. In Clark's Gas Engine, \$2 by mail, you will find these theoretical points considered. We also recommend! Robinson's Gas and Petroleum Engines,

(3858) A. G. S. and A. T. ask concerning relative merits of shorthand systems. A. It is claimed that Pitman's system is more extensively used than any other shorthand method. We can supply manuals in any system, such as Pitman's "Shorthand or Phonography," 40 cents; ditto "Teacher," 10 cents: Munson's "Complete Phonographer," \$1.50; Burnz "Fonic Short2 hand," \$1; Graham's "Hand Book of Phonography," \$2; Munson's "Phonographic Phrase Book," \$2.50.

(3859) "Danville" asks: 1. What kind of pith is used in making figures for an ano-kano? Will pith out of corn stalks answer the purpose? A. The best pith for the purpose is sunflower stalk pith. The other piths will answer however. 2. Does the box need to be air tight? A. No. 3. Which side of the leather should go out—the black or the red? A. The natural uncolored side of the leather or kid. 4. How much bisulphide of tin does it take to put in the pad? A. As much as will spread over its surface. 5. What is the illuminating paint made of? A. From calcium or barium sulphide; see our Supplement, Nos. 229, 249, 497 and 539, and the Scientific American, No. 10, vol. 65, and No. 19, vol 65.

H. H. asks for a varnishing ink.—S. E. N. asks for a varnish for rubber overshoes.—S. R. asks how to dye brown.- C. P. J. asks: Please describe fully the manufacture of enamel signs and sign letters .- J. C. S. asks how to silver glass by solution,—E. D. asks for receipts for engine oils, cylinder oil, axle grease.—J. H. B. and C. H. M. ask for furniture polishes.

Answers to all of the above queries will be found in the "Scientific American Cyclopedia of Receipts, Notes and Queries," to which our correspondents are referred. The advertisement of this book is printed in another

TO INVENTORS.

An experience of forty years, and the preparation of more than one hundred thousand applications for patents at home and abroad, enable us to understand laws and practice on both continents, and to possess un-MUNN & CO., office Scientific American, 361 Broadway, New York.

INDEX OF INVENTIONS

For which Letters Patent of the United States were Granted

December 29, 1891,

AND EACH BEARING THAT DATE.

[See note at end of list about copies of these patents.]

around the wrist, but without cure. A. After the remedite half of the son much so in the second case. The friction of the air would retard the fall in proportion to the relative weights and bulk. In the first case the weights will be alike, but the balk of the wood will largely exceed the lead and furnish a larger area to the resistance of the air. In the second case, the size being the same, the difference in weight will give the lead about fifteen times greater weight, while the resistance of thear is the same with both wood and lead. It is only in a vacuum that the fall would be alike.

(3845) G. W. H. says: Please inform me if there is, and how to make, a paint to be applied inside a tin vessel to prevent it rusting, vessel to con-

Beard, Ed., Chicago, Il., condenser.

Beaumont, J. W., St. Louis, Mo., wall for build
Beaumont, J. W., St. Louis, Mo., roofing.

Beaumont, J. W., St. Louis, Mo., roofing.

Beaumont, J. W., St. Louis, Mo., roofing.

Beacher, Hans C., San Fran., L., measuring work.

Berhringer, Chas., Defiance, Ohio, tongue support
Berlepsch, H.J., Providence, R. L., finger ring.

465,213

Beseler, Chas., Jersey City, N. Y., piano action.

Beseler, Chas., Jersey City, N. J., stereopticons.

Beseler, Chas., Jersey City, N. J., stereopticons.

Bettendorf, Wm. P., Davenport, Iowa, cultivator.

466,127

Bettendorf, Wm. P., Davenport, Iowa, cultivator.

466,128

Bettendorf, Wm. P., Davenport, Iowa, cultivator.

466,128

Billings, A. W., Brooklyn, N. Y., beer and ale.

466,151

Billings, A. W., Brooklyn, N. Y., beer and ale.

466,161

Bishman, G. A., Brookings, S. D., sulky plow.

466,101

Bishman, G. W., Waterville, Me., heating tool.

466,102

Boosen, Wm. J., Orange, N. J., lamp shade.

466,103

Boonarfoo, Albert L., Phila., Pa, fence.

466,104

Brand, J. B. & P. L., Sheridan, Milwauke, Wis.,

door lock.

Brasndshan, P. L. R., & A. Fritschi, Suisun, Cal.,

Braun, O., Berlin, Ger., power transmitting device,

466,114

Brown, Dillon S., Genoa, Ill., thill coupling. 465,918
Brown, G. W., & A. Taplin, Forestville, Conn., lamp. 466,029
Brown, Perry, Sharonville, Ohio, car coupling. 465,229
Brown, Perry, Sharonville, Ohio, car coupling. 465,229
Brown, S. H., Boston, Mass., carburizing metals 465,528
Browne, Hugh M., Wash. D. C., fire alarm. 465,829
Browne, Oliver L. F., Syracuse, N. Y., rake. 465,929
Buffington, T. H., Berrysburg, Pa., screw driver. 465,228
Buffington, T. H., Berrysburg, Pa., screw driver. 465,229
Buffington, T. H., Berrysburg, Pa., screw driver. 465,221
Buffington, T. H., Berrysburg, Pa., screw driver. 465,221
Buffington, T. H., Syracuse, N. Y., carring. 465,830
Bunker, H., Toronto, Canada, car coupling. 466,221
Burt, Lee. Detroit. Mich., gass burner. 466,121
Buttl. Lee. Detroit. Mich., gass burner. 466,193
Buttler, Wm. J., Woodstock, Can., railway signal. 466,193
Buttlin, Chas. H., Camborne, England, curb bit. 467,222
Cady, F. P., Clev., Ohio, chain making machine. 466,193
Cambell, Mark, Cheago, Ill., crimping iron. 456,057
Carr, R. S., & E. J. Schroder, Hamilton, O., reversing mechanism.
Cartwright, G. J., Sydney, N. S. Wales, botler. 465,181
Casler, Alonzo, Otto, N. Y., washang machine. 466,022
Cavalli, J. London, Eng., ornamenting tablets. 468,032
Cavalli, J. London, Eng., ornamenting tablets. 468,833
Champion, P. C. E., Paris, France, telegraphy. 465,831
Chase, Henry A., Boston, Mass., signal system. 465,981
Chase, Henry A., Boston, signal transmitting mech.

Edison, T. A., Mentol Park, N. J., transmitting Edison, T. A., Menlo Park, N. J., transmitting Signals.

Buson, James H., Rutland, Vt., tooling marble...

Edwards, W. J., Chicago, Ill., velocipede...

Egley, Jacoh D., Pittsburg, Pa., pencil sharpener. Egley, John C., Philadelphis, Pa., knitting mach...

Elichbaum, W. J., Mt. Vernon, N. Y., store serv. app. Eliflander, Charles, Newark, N. J., spring hinge...

Elilworth, Hermon, G., Lockport, N. Y. churn...

Emmner, J., Jr., Wash, D. C., electric rallway...

Engelhardt, Richard H., Berlin, Germany, chu...

Eno, J. A., Newark, N. J., steam generator...

Enos, Fred., Bridgeport, Conn. car coupling...

Erieto, J. A., New Britain, Cl., game register...

Evered, William, Detroit, Mich., pump...

Ewinger, W. O., Burlington, Ia, water beater...

Passolet, Ernest C., Albany, N. Y., pressure regulator...

lator.

Faunce, Z. T., Camden, N. J., blackboard ruler...
Fender, W. J., Minneapolis, Minn., middlings grader.

Ford, J. C., Beverly, Mo., mach. splitting paper.
Ford, L. E., & A. J. Whitworth, McComb, Miss.,
car coupling.
Foster, C. E., Wash., D. C., store service apparatus
Fraser, G., Auckland, New Zealand, mill for ores.
Fulkerson, Charles H., Raum, Ill., planter.
Fuller, Harvey R., Butler, Ind., lead pencil.
Gazin, C. M., Pepperell, Mass., matrix board.
Gaither, Ira H., Alberton, Md., endless conveyer.
Geddes, J., Rochester, N. Y., hot air register.
Gent, J. F., Columbus, Ind., macaroni.
Goldberg, Nehemiab, Phila., Pa, step ladder.
Gordon, E. F., Concord, N. H., engine valve.
Gornall, Richard, Balt., Md., store service app.
Gray, A. Butte City, Mont., mining cages.
Gray, A. G., St. John, Canada, car door.
Gray, Hiram W., Little Rock, Ark., nut lock.
Green, B. R., Washington, D. C., bookstack.
Green, John H., Bluffton, Ind., bag tie.
Greer, John Greensborough, N. C., bracket.
Griffin, D., & J. A. Markoe, St. Paul, Minn., clay
pulverizer.

Griffin, D., & J. A. Markoe, St. Paul, Minn., clay pulverizer. 466,034
Grinnes, Phillips B., Glenwood, Mo., nut lock. 465,835
Grubb, W. S., Chicago, non-conduct. coverings. 465,035
Guess, Carl H. Buffalo, N. Y., corn extractor. 465,035
Guitafson, A. R., Milwaukee, thrashing mach. 465,085
Gustafson, A. R., Milwaukee, thrashing mach. 465,085
Gustin, F. M., & A. P. Olson, Fort Madison, Iowa, wedge.

wedge. Hackett, William S., Roanoke, Ind. trunk.....

Hackett, William S., Roanoke, Ind. trunk.
Hahn, T., Stuttgart, Ger., time locks.
Hain, C. W., Columbus, O., time locks.
Hall, C. L. San Fran. Cal., valve for byd. elev...
Hallensteine, R., Melbourne, Victoria, batchways
Harper, E., & P. G. Metzler, Leaeville, Col.,
wrench, & P. G. Metzler, Leaeville, Col.,
Harsin, C. D., Stockton, Cal., fire extinguisher.
Hasty, J. P., Superior, Neb., car coupling.
Hauck, Philip, Phila., Pa., knockdown grate.
Hazand, F. J. H. Toronto, Can., cash carrier.
Hazand, F. J. H. Toronto, Can., cash carrier.
Hazand, C. D., Eupora, Miss., planter and fertilizer.
Head, T. O., Eupora, Miss., planter and fertilizer.
Haden, J. S., & O. L. Beasley, Pleasant Hill, Mo.,
lacel.

© 1892 SCIENTIFIC AMERICAN, INC

Scientific

Sevent, Astron, Alverson, Ruis, sevent, colors, sevent, sevent, Astron, Alverson, Ruis, sevent, Carlot, Anderstein, N. v., 190-101.

Sevent, Astron, Alverson, Ruis, sevent, colors, sevent, seven

stopper. 465.883

Phillips, H., N. Y. City, electric pendulum clock. 465.011

Pinkham, Fred S., Lynn, Mass., door crape. 465.834

Ponzio, G., & D. Robbiati, Milan, Italy, buttons. 465.834

Porteous, J., Fresno, Cal., vineyard brush burner. 465.834

Price, J. Briag, Pa., rolling mill. 465.937

Price, J. W., London, Eng., extinguisher for lamps. 465.936

Price, S. M., & J. F. Klaiss, Bloomville, O., clothes

drier. 465.883

BOILERS

ENCINES AND SAW MILLS.

-SEND FOR CATALOGUE.-

NO FARQUHAR BOILER EVER EXPLODED. A. B. Farquhar Co. (Limited,) York. Pa.

Modvertisements.

Inside Page, each insertion - - 25 cents a line Inside Page, each insertion - - 75 cents a line
Back Page, each insertion - - - \$1.00 a line
'he above are charges per agate line—about eight
words per line. This notices hows the width of the line,
and is set in agate type. Engravings may head advertisements at the same rate per agate line, by measurement, as the letter press. Advertisements must be
received at Publication Office as early as Thursday
morning to appear in the following week's issue.

USE ADAMANT WALL PLASTER



It is Hard, Dense, and Adhesive. Does not check ar crack. It is impervious to wind, water, and disease verms. It dries in a few hours. It can be applied in any kind of weather. It is in veneral use. Licenses tranted for the mixing, using, and selling.

Address ADAMANT MFG. CO.



LATHE

Seneca Falls Mfg. Co. 695 Water St., Seneca Falls, N.Y.

Improved Screw Cutting LATHES Foot and Power.

Drill Presses, Shapers, Band, Circular, and Scroll Saws Machinists' Tools and Supplies. Lathes on trial.

Totalogue mailed on application. SEBASTIAN LATHE COMPANY, 44-46 Central Ave., Cincinnati, O.



Our new General Circular "S. A.," showing specimens of all our work, is now ready. Send stamp and particulars for estimates.

RET SAW or BRACKET

Planed Ready for Use. Books of Design.
Send stamp for catalogue.

CABINET WOODS AND VENEERS.
THE E. D. ALBRO CO.,
Eastern Branch. 200 Lewis St., New York, U. S. A.
H. T. Bartlett, Mg'r. F. W. Honerkamp, Ass't Mgr.
Mills, Cincinnati, Ohio.

U. S. INFALLIBLE METAL POLISH. IN PASTE, LIQUID OR POWDER.

Invariably gives unbounded satisfaction. Dealers and Agents always find them quick sellers. Agents always and them quick sellers.

G. WM. HOFFMAN, Manu'fr,
No. 69 E. Washington Street, Indianapolis, Indiana.






SPECIAL NOTICE!

Two handsome photo-engraved display sheets entitled, "Recent Improvements in Air Compressors," "Recent Improvements in Rock Drills," mailed free to any one who will cut out this advertisement and mail it to us with his name and address.

INGERSOLL-SERGEANT DRILL CO.
No. 10 Park Place, New York, U.S. A.

NOW READY!

A NEW AND VALUABLE BOOK.

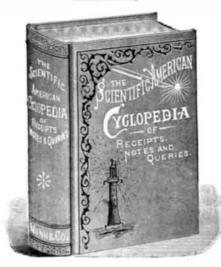

12,000 Receipts. 680 Pages. Price \$5.

This splendid work contains a careful compila-tion of the most useful Receipts and Replies given in the Notes and Queries of correspondents as pub-lished in the **Scientific American** during the past fifty years; together with many valuable and important additions. **Over Twelve Thousand** selected receipts are here collected; nearly every branch of the use-ful arts being represented. It is by far the most comprehensive volume of the kind ever placed be-fore the public.

fore the public.

The work may be regarded as the product of the studies and practical experience of the ablest chemists and workers in all parts of the world; the information given being of the highest value, arranged and condensed in concise form convenient

ranged and condensed in concise form convenient for ready use.

Almost every inquiry that can be thought of, relating to formulæ used in the various manufacturing industries, will here be found answered.

Instructions for working many different processes in the arts are given.

It is impossible within the limits of a prospectus to give more than an outline of a few features of so extensive a work.

to give more than an outline of a few features of so extensive a work.

Under the head of Paper we have nearly 250 receipts, embracing how to makepapier maché; how to make paper water proof and fire proof; how to make sandpaper, emery paper, tracing paper, transfer paper, carbon paper, parchment paper, colored papers, razor strop paper, paper for doing up cutlery, silverware; how to make luminous paper, photograph papers, etc.

Under the head of Inks we have nearly 450 receipts, including the finest and best writing inks of all colors, drawing inks, luminous inks, invisible inks, gold, silver and bronze inks, white inks; directions for removal of inks; restoration of faded inks, etc.

faded inks, etc.
Under the head of Allovs over 700 receipts are given, covering a vast amount of valuable infor-

given, covering a vast amount of valuable information.

Of Cements we have some 600 receipts, which include almost every known adhesive preparation, and the modes of use.

How to make Rubber Stamps forms the subject of a most valuable practical article, in which the complete process is described in such clear and explicit terms that anyintelligent person may readily learn the art.

For Lacquers there are 120 receipts: Electro-Metallurgy, 125 receipts; Bronzing, 127 receipts; Photography and Microscopy are represented by 600 receipts.

tallurgy, 1.25 receipts; Bronzing, 127 receipts; Photography and Microscopy are represented by 600 receipts.

Under the head of Etching there are 55 receipts, embracing practical directions for the production of engravings and printing plates of drawings.

Paints, Pigments and Varnishes furnish over 800 receipts, and include everything worth knowing on those subjects.

Under the head of Cleansing over 500 recipes are given, the scope being very broad, embracing the removal of spots and stains from all sorts of objects and materials, bleaching of fabrics, cleaning furniture, clothing, glass, leather, metals, and the restoration and preservation of all kinds of objects and materials.

In Cosmetics and Perfumery some 500 receipts are given.

Soaps have nearly 300 receipts.

Those who are engaged in any branch of industry probably will find in this book much that is of practical value in their respective callings.

Those who are in search of independent business or employment, relating to the home manufacture of sample articles, will find in thundreds of most excellent suggestions.

MUNN & CO., Publishers,

SCIENTIFIC AMERICAN OFFICE,

361 Broadway, New York,

ELECTRIC COAL CUTTERS

ELECTRICAL MINING APPARATUS OF EVERY DESCRIPTION.

Send for Illustrated catalogue M 2.

THOMSON-VAN DEPOELE ELECTRIC MINING CO., 620 ATLANTIC AVE., BOSTON, MASS.